


Sansui SERVICE BULLETIN

June 1, 1970

Ref. CE-013

Subject: MODIFICATION OF THE POWER CIRCUIT
 Model: 2000A

1. If noise (input shorted) is noticeable in the power amplifier sections, change the connecting wire and grounding point in the power circuit.
 See Fig. below:

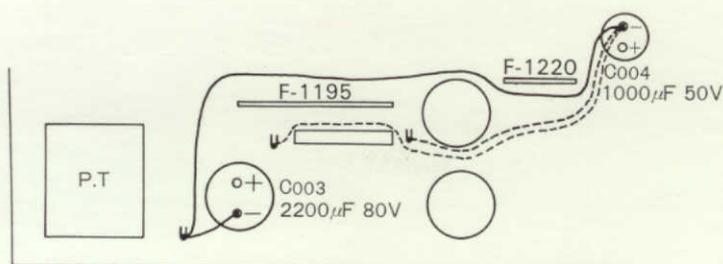

2. If Hum level is noticeable on PHONO 1 or 2 of the SELECTOR, insert the ripple filter between the equalizer amplifier "F-1253 (+B) and power circuit" F-1195 (5).
 See Fig. below:

